



Industrial Weighing Systems

9 Richmond St. Picton, ON Canada K0K 2T0

Ph: 613-786-0016 Cell: 613-921-0397 Fax: 613-476-5293

E-mail info@iwsystems.ca Website: www.iwsystems.ca

Model AP-4K is not Nema-4 rated and should not be directly sprayed or used in a wet area.



Ensure the platter is empty and clean and the unit has been powered for at least 10 minutes prior to calibration.

Power off the display, remove the screw from the right hand side of the unit about mid frame. Insert a screwdriver or device into the hole to depress the program button.

While holding in on the button power up the device to show: **int.**

If this is not shown power down and retry holding in on the button.

Continue to press the **NET** key until the **LoAd=** is displayed

Note the update is very slow on this scale, do not press keys quickly and hold for display change.

Place your calibration weight on the scale normally the full 4000 Grams

Press the **NET** key display shows **0**

Use the **GROSS** key to move to a desired digit starts from right to left, keep pressing if you miss.

Use the **TARE** key to change to selected flashing digit (0-9), keep pressing if you go past.

When the display matches the test weight press **NET**, the display will dash and then show **UnLOAD**

Remove the calibration weight from the scale, wait a few seconds then press the **NET** key.

The display should show **trA=**

Continue to press the **NET** key until **DOnE** is displayed

Pressing **NET** once more should exit the program menu and display weight.

*** Depending on the software revision this may not occur, if it still shows **DOnE** power off then on ***

Test the scale with several weights to ensure calibration was successful.